RT302 Rotary Temperature Transmitter (850-396)

The RT302 rotary temperature transmitter is a digital system designed to accurately transmit temperature data from RTD sensors embedded in a heated godet roll shell. The system consists of three components: The **RT302R** rotary assembly, the **RT300S** stationary assembly, and the **RT302C** controller interface assembly.



Installation

1. Slide the RT302R rotary assembly onto shaft with steel base toward motor. Tighten the (2) M6 x 1.0 compression screws (alternating from one screw to the other) to lock assembly onto shaft.


Note: The RT302R requires proper positioning on the shaft; see Step 5 below for details.

- 2. Secure RTD leads with the 4-40 x 1/4" socket head cap screws provided.
- 3. **IMPORTANT!** Pull excess RTD leads towards the front of the godet roll to be stored under the godet cover. This prevents lead wires from rubbing against inside cover of RT300S stationary housing during rotation.
- Carefully position the RT300S stationary housing over shaft-mounted RT302R transmitter and mount it to the motor housing using the (4) M8-1.25 x 20 mm long socket head cap screws and lock washers provided.
- IMPORTANT! Refer to the Installation Diagram to verify correct axial spacing between rotor and stator using either of the following methods:


<u>Visual Alignment</u>: sight the outer face of the rotor through the side ventilation holes in the stator.

<u>Measured Alignment</u>: insert a steel scale through the ventilation slots in the cover of the stator and measure $32 \pm 3 \text{ mm}$ from the stator (RT300S) cover to the outer face of the rotor.

- 6. DIN rail (35mm) mount the RT302C current controller interface at a convenient location. CAUTION: To promote airflow and prevent overheating, the RT302C must have at least 25 mm clearance above and below the enclosure.
- Connect one end of the provided coax cable to the BNC plug on the RT300S stationary housing and the other end to the BNC plug on the RT302C.
- Connect a power source to the proper terminals indicated on the RT302C. Acceptable power is 23-30VDC or 18-23VAC.
 CAUTION: Power source must be isolated from current output.
- 9. Connect the 4-20mA output terminals on the RT302C to the godet heater process controller.
- 10. Allow 30 seconds for start up.

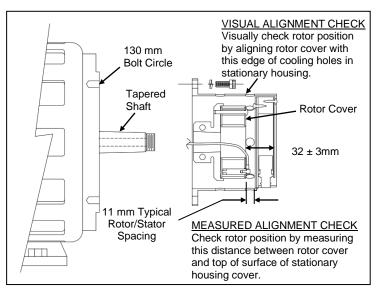

Installation Diagram

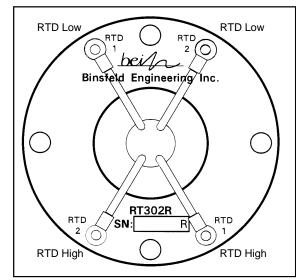

Rotor-RTD Wiring Diagram

RT302 Rotary Temperature Transmitter (850-396)

Troubleshooting

In normal operating mode the Power status light, the Data status light and the Channel (Ch) status light are all on solid. In error mode, one or more of the lights on the RT302C Controller Interface will flash <u>and a high temperature signal</u> (approximately 24 mA) will be output. Refer to the table below when troubleshooting an error mode event.

| <u>Power Status</u> On solid Flash fast (5Hz) | Condition Stator & rotor power in spec | Corrective Action | Binsfeld Engineering |
|---|---|--|-----------------------------------|
| Flash slow (2Hz) | Rotary power out of spec Stationary power out of spec | Check rotor/stator spacing, and coaxial connections Check power source | RT302C ● Power Ch1 ● ● Data |
| Off | System not powered | Check power source, and power connections | bei∕ Ch2 ● © Cal Fuse (2A) |
| 10 sec on/1 sec off [Data light off, RTD light(s) blinking] | Insufficient rotary power or data not received (Rotor Reset mode) | Check rotor/stator spacing, and coaxial connections | |
| <u>Data Status</u> On solid | Condition Digital transmission is error-free | Corrective Action | -triput ch1 = 0 |
| Flickering | Intermittent transmission errors | Check rotor/stator spacing, and coaxial connections | Power Input Power Input |
| Off | Data not received | Check rotor/stator spacing, and coaxial connections | Stator |
| <u>Ch 1 - 2 Status</u> On solid | Condition No errors detected | Corrective Action | |
| Flash fast (5Hz) | Rotary side error: RTD out of range (including | Check RTD, connections | SN: C |
| Flash slow (2Hz) | open or shorted) Open circuit in 4-20mA loop | Check connections and | Status Indicators & I/O Diagram |
| | continuity of current loop | | |

If the status lights do not agree with conditions listed above, remove power to the RT302C for 5 seconds, and then restore power (to reset the digital circuitry). Go to <u>http://www.binsfeld.com/temptrak/rt300/</u> for more trouble shooting aids.

Specifications

| Rotor: | Number of sensors: Sensor connection: Input sensor type: Sensor range: Speed: | 1 - 2 #4-40 screw terminals with socket-head cap screws PT2000 RTD (2000 Ω at 0°C, α = .00385, two wire) 0 - 300° C 10,000 RPM |
|--------------------------|---|--|
| Stator: | Connector: | Coaxial interconnect (BNC) |
| Controller Interface: | Output connection: Output signal: Power input: Max load resistance | Quick connect screw terminal block. 4-20 mA (Linear with 0° to 300° C) 23-30 VDC or 18-23 VAC, 2 A max, 1 A nominal 400 Ω |
| General: | Accuracy (typical error): Operating temperature: Humidity: | ±0.30% span over operating temperature range 0 – 100° C 0 – 90% RH, non-condensing |

This document is subject to change without prior notification.

Warranty

Binsfeld Engineering Inc. warrants this product to be free from defective materials and workmanship for a period of five years from the date of delivery to the original purchaser and that this product will conform to specifications and standards published by Binsfeld Engineering Inc. Upon evaluation by Binsfeld Engineering Inc., any product found to be defective will be replaced or repaired at the sole discretion of Binsfeld Engineering Inc. Our warranty is limited to the foregoing. Binsfeld Engineering Inc. disclaims any warranty of merchantability or fitness for intended purpose.